



www.BeSoji.com



PRE-PURCHASE YELLOW BOOK

BESOJI FZ-LLC

+971 56 817 8171

IN5 TECH, MEDIA CITY

HELLO@BESOJI.COM



Type Of Inspection

Comprehensive Inspection

Date

Saturday, September 14, 2024

Time

02:30 PM

Vehicle Details

Make

BMW

Model

M6

Year

2007

Engine Size

10-Cylinder

Mileage (KM)

134955

Fuel Type

Petrol

Regional Specs

GCC

Transmission

Automatic

Interior

Leather

VIN Number

WBSEH91016B778752

Number of Keys

1

Spare Tire

Not Available

Vehicle Summary

We've explained **some** of the faults below.
Please refer to the full report for all the faults.

RPM Fluctuating

- RPM is fluctuating and can indicate issues such as a malfunctioning idle air control valve, dirty fuel injectors, spark plugs, and/or vacuum leaks, leading to inconsistent engine performance. Labor cost: Medium To High

Inspector Comments

Test drive done inside small parking area, since the car doesn't have licence plates.

Repair cost ranges are general and not final. We offer these estimates to provide you more clarity on deciding if you should buy the car or not. These estimates may vary depending on the vehicle make and model, current labor rates, time period issue is present and the complexity of the repair.

Engine Upper Cover

Pass

Engine Shield Cover

Pass

Engine Mounts

Pass

Engine Oil Condition

No dipstick available

Engine Oil Leaks

Oil residue around valve cover gasket

Engine Oil Filler Cap

Pass

Engine Oil Leak Fault - Photo



190_1726314411012...

Coolant Level

Pass

Coolant Cap

Pass

Turbo / Supercharger

N/A

Visible Rust

Pass

Exhaust System

Exhaust modified

Engine Idle

RPM is fluctuating

Exhaust Leak Fault - Photo



195_1726314411180...

Bonnet Hinge & Holder

Pass

Fender Liners

Pass

Drive Belt / Pulleys

Pass

Hoses & Pipes

Pass

Radiator

Pass

Battery Condition ⚡ ⚡ ⚡ ⚡ ⚡

Fluid Level & Condition

No Dipstick Available To Check

Transmission Fluid Leaks

Leak from rear differential

Transmission Fluid Fault - Photo



287_1726314411097...



287_1726314411125...

Gear Selector

Pass

Gear Shifting

Pass

Noise

Pass

Please review the car diagnostic report at the end of this document for more information on the transmission condition.

Key Remote

Pass

Entertainment System

Pass

Center Console Buttons

Pass

Door Lock / Unlock

Pass

Cameras

N/A

Cruise Control

Pass

A/C Control & Cooling

Pass

Starting & Ignition System

Pass

Gauges

Pass

Fog Lights

Pass

Headlights

Pass

Brake Lights

Pass

A/C Grilles

Pass

High Beams

Pass

Reverse Lights

Pass

Number Plate Lights

Pass

Indicators & Hazards

Pass

Soft Closing Doors

N/A

Wipers

Pass

Interior Lights

Vanity mirror light faulty

Sunroof / Moonroof

N/A

Windows Operation

Pass

Seats Adjustment

Pass

Rear View / Side Mirrors

Pass

Horn

Pass

Parking Sensors Fault

Pass

Brake Pads Front

Pass

Brake Pads Rear

Pass

Brake Discs Front

Pass

Brake Discs Rear

Pass

ABS Sensors

Pass

Handbrake

Pass

Front Suspension

Pass

Rear Suspension

Pass

Rims

	Brand	Condition
Front Left	Original	Good
Front Right	Original	Good
Rear Left	Original	Good
Rear Right	Original	Good

Tyres

	Manufacturer	Date	Size	Condition
Front Left	Michelin pilot sport	2022	255/40R19	7/8mm
Front Right	Michelin pilot sport	2022	255/40R19	7/8mm
Rear Left	Michelin pilot sport	2022	285/35ZR19	6/8mm
Rear Right	Michelin pilot sport	2022	285/35ZR19	6/8mm

Roof Lining

Pass

Rear View Mirror

Pass

Armrest & Side Pockets

Pass

Steering Wheel Upholstery

Pass

Seats Upholstery

Pass

Gear Lever

Minor scratches

Gear Lever Fault



250_IMG_20240914_...

Floor Mats

Pass

Trunk Lining

Pass

Dashboard

Damage on left corner

Dashboard Fault



253_IMG_20240914_...

Front Windscreen

Pass

Rear Windscreen

Pass

Doors

Pass

Service History & Manuals




Service History

Not Available

User Manual

Not Available

Paint Condition Report

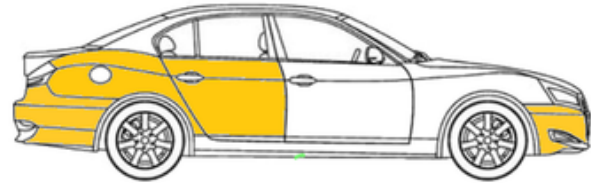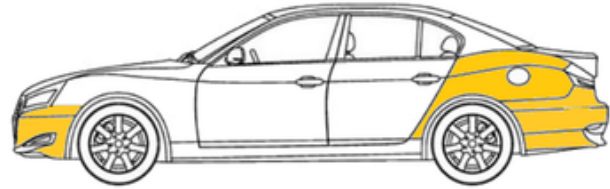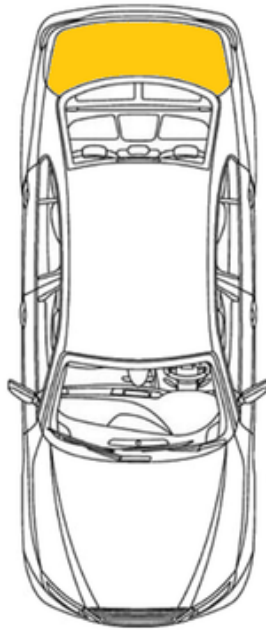


Key Details

- **Scratch:** A minor or major scratch
- **Paint Chip:** A small to medium part of the paint has been removed
- **Dent:** A minor or major depression or hollow on the vehicle body
- **Accident Paint:** Filler used to smoothen out the panel due to a deep crack or damage, followed by repainting of the panel.
- **Cosmetic Paint:** No filler used, usually a repaint due to minor imperfections on the paint. e.g. stone chips, door dings, etc.
- **Faded:** Paint and/or lacquer has been worn out due to extreme weather. Appears as a dull, washed out appearance and, at times discoloration.



Chassis, Subframe & Internal Damage Report

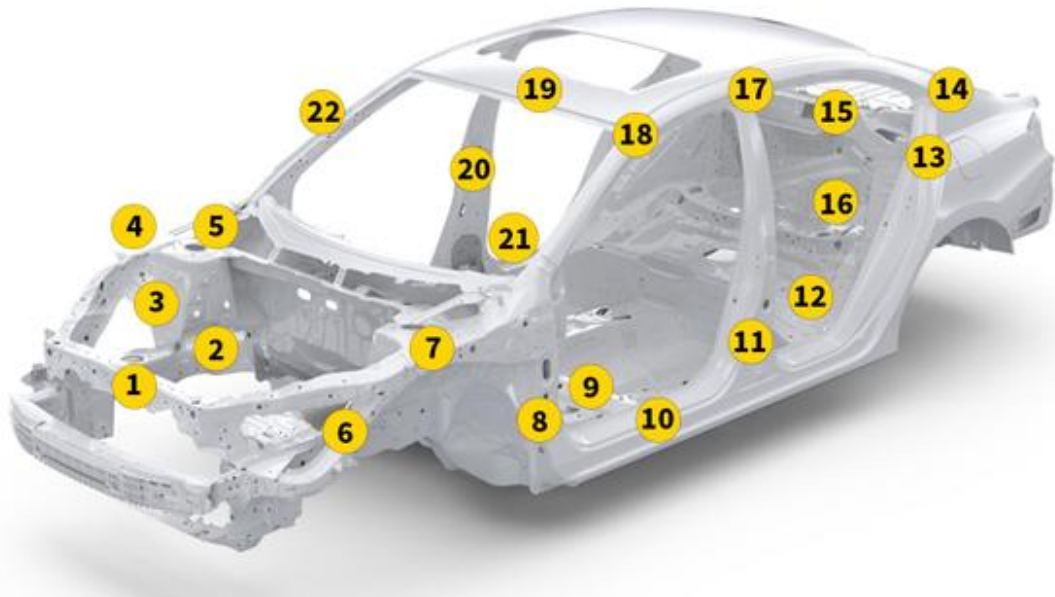

Damage on Chassis / Subframe:

PASS

General Exterior Photos



IMG_20240914_1435...
1.7 MB



IMG_20240914_1436...
550.93 KB



IMG_20240914_1436...
525.35 KB



IMG_20240914_1436...
526.4 KB



IMG_20240914_1436...
550.33 KB



IMG_20240914_1436...
546.98 KB



IMG_20240914_1436...
568.98 KB



IMG_20240914_1437...
554.21 KB



IMG_20240914_1437...
562.45 KB



IMG_20240914_1437...
571.82 KB



IMG_20240914_1437...
559.85 KB

Engine Bay & Undercarriage



1726314277401.jpg
248.99 KB



1726314277442.jpg
274.4 KB



1726314277462.jpg
241.03 KB



1726314277482.jpg
202.67 KB



1726314344118.jpg
280.78 KB



1726314344134.jpg
329.1 KB



1726314344149.jpg
318.65 KB



1726314410915.jpg
215.28 KB



1726314410938.jpg
282.47 KB



1726314410952.jpg
247.34 KB



1726314410969.jpg
237.49 KB



1726314410988.jpg
249.44 KB



1726314411012.jpg
298.97 KB



1726314411028.jpg
214.73 KB



1726314411045.jpg
250.86 KB



1726314411066.jpg
216.3 KB



1726314411083.jpg
200.52 KB



1726314411097.jpg
280.78 KB



1726314411125.jpg
329.1 KB



1726314411142.jpg
318.65 KB



1726314411162.jpg
248.99 KB



1726314411180.jpg
274.4 KB



1726314411199.jpg
270.51 KB



1726314411226.jpg
262.17 KB




1726314411255.jpg
241.01 KB



1726314411278.jpg
241.03 KB




1726314411303.jpg
202.67 KB



1726314411322.jpg
261.46 KB



1726314411338.jpg
235.96 KB



1726314411357.jpg
246.35 KB



1726314411379.jpg
247.67 KB



1726314411397.jpg
194 KB



1726314411417.jpg
248.72 KB



1726314411437.jpg
253.88 KB



1726314411456.jpg
221.39 KB



1726314411478.jpg
169.12 KB



1726314411499.jpg
227.57 KB



1726314411518.jpg
173.41 KB



1726314411538.jpg
211.58 KB



1726314411557.jpg
278.91 KB



1726314411580.jpg
226.06 KB



1726314411598.jpg
213.07 KB



1726314411615.jpg
215.25 KB



1726314411639.png
426.11 KB

Interior Photos



102_IMG_20240914_...
526.4 KB



102_IMG_20240914_...
550.33 KB



IMG_20240914_1446...
521.1 KB



IMG_20240914_1503...
562.79 KB



IMG_20240914_1503...
561.53 KB



IMG_20240914_1503...
593.67 KB



IMG_20240914_1503...
523.88 KB



IMG_20240914_1504...
494.93 KB



IMG_20240914_1504...
486.85 KB



IMG_20240914_1504...
594.53 KB



IMG_20240914_1504...
560.9 KB



IMG_20240914_1504...
520.66 KB



IMG_20240914_1505...
548.71 KB



IMG_20240914_1506...
516.36 KB



IMG_20240914_1511...
523.57 KB



IMG_20240914_1511...
514.21 KB



IMG_20240914_1512...
539.16 KB

Vehicle Diagnostic Report

PDF

BMW(DTC)_989350006769_20240914034825.pdf

**WE JUST OUTPERFORMED YOUR INSURANCE BROKER**

We've built the insurance experience from the ground up!

- Get Car Insurance Without Talking To A Human - For The First Time Ever!
- Lowest quotes, transparent pricing, instant cover available 24/7. Policy issued to RTA in 3 minutes.

TRY THE MAGIC

Terms of Service

All services from BeSoji are provided on an "as is, with all defects" and "as available" basis without warranties of any kind, either expressed or implied, including without limitation, warranties of title, non-infringement, or implied warranties of merchantability or fitness for a particular purpose. Nothing in these terms or in any description of products or services in the services shall constitute a representation or warranty with respect to such products or services.

The inspection of the vehicle described in this report is external and we are unable to accept responsibility for failure to identify defects not present or apparent at the time of the inspection. Odometer readings may have been tampered with, although we report any signs that we notice of this happening during inspection. You acknowledge, by your use of the services, that such use is at your sole risk. In the event of dissatisfaction or a complaint, we reserve the right to re-examine the vehicle prior to any rectifications to the vehicle. You agree that BeSoji's liability is limited to refunding the price you pay for the inspection in the event you are dissatisfied with BeSoji's service, or injuries occur due to an unreported defect in the vehicle. All requests should be sent to hello@besoji.com within 7 days notice of receiving the report.

In no event shall either BeSoji or its affiliates or agents be liable for any direct, indirect, punitive, incidental, special or consequential damages arising out of or in any way connected with the use of the services, whether based on contract, tort, strict liability or otherwise, even if advised of the possibility of any such damages.